



Make entries in yellow shaded areas only										
	-	1	2	3	4	5	6	7		
	M/D/Y	J	F	M	А	М	J	J		
Discharg	ge in cubic f	eet per seco	nd							
	Q A72	64	63	77	155	682	1196	625		
	Q M34	22	22	28	58	266	468	243		
	Q CC48	14	13	15	22	91	158	83		
	Q A68	25	25	31	66	329	585	300		
Total Cu	ı in ug/l									
	C A72	24	32	44	49	37	21	15		
	C M34	52	58	67	66	44	24	19		
	C CC48	36	35	41	58	86	90	85		
	C A68	12	19	23	22	20	17	12		
Change	in pounds p	er day								
	A 72	-7	-8	-11	-18	-28	-38	-26		
	M34	-6.00	-7.00	-10.00	-15.77	-16.30	-17.74	-17.11		
	CC48	-1	-1	-1	-2	-10	-18	-7		
	A68	0	0	0	-1	-2	-3	-2		
Remedia	ation Concei	ntration in uç	g/l							
A 72	New Cond	3	8	16	27	30	15	7		
M34	New Cond	3	0	0	16	32	17	6		
CC 48	New Cond	25	25	29	40	65	69	69		
A68	New Cond	10	17	21	21	19	16	11		
TVS Co	ncentration i	n ug/l								
A 72	TVS	11	11	10	8	4	3	3		
M 34	TVS	20	19	18	14	8	6	7		

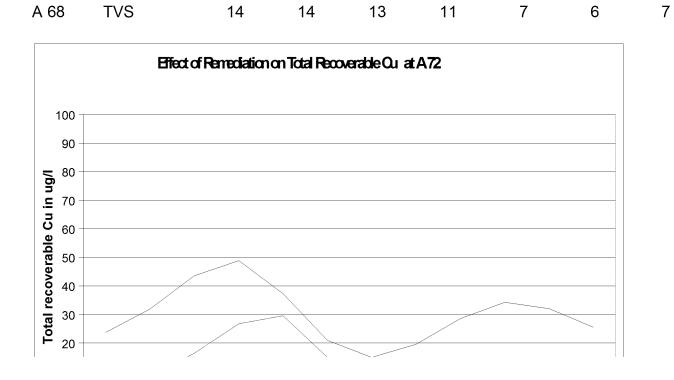


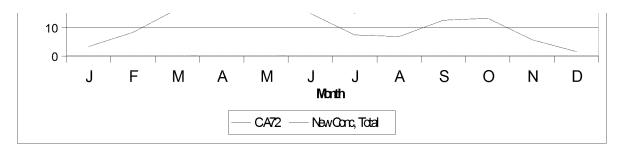


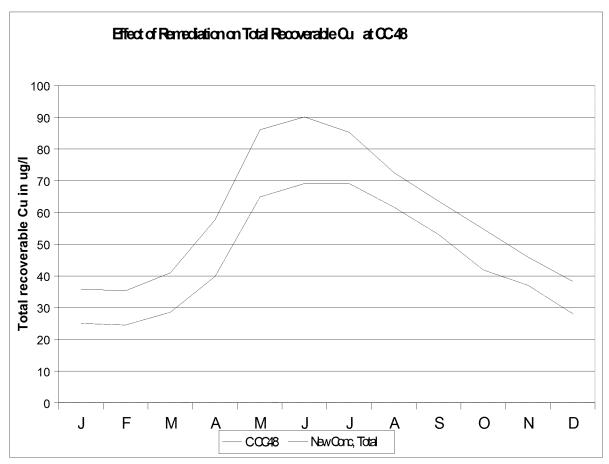

8	9	10	11	12
Α	S	0	N	D
			- 2	
268	187	142	92	70
103	71	53	33	25
37	26	20	16	14
122	82	60	38	28
20	29	34	32	25
33	52	65	66	57
73	64	55	46	38
10	8	6	40	6
10	O	O	4	0
-18	-16	-16	-13	-9
 -15.76	-14.41	-14.42	-12.00	-8.00
-2	-14.41 - 1	-14.42 - 1	-12.00 - 1	-1
	-14.41 -1 0			
-2 -1	-1 0	-1 0	-1 0	-1 0
-2 -1 7	-1 0	-1 0	-1 0	-1 0 2
-2 -1 7 4	-1 0 13 14	-1 0 13 14	-1 0 6 -1	-1 0 2 -2
-2 -1 7 4 62	-1 0 13 14 53	-1 0 13 14 42	-1 0 6 -1 37	-1 0 2 -2 28
-2 -1 7 4	-1 0 13 14	-1 0 13 14	-1 0 6 -1	-1 0 2 -2
-2 -1 7 4 62	-1 0 13 14 53	-1 0 13 14 42	-1 0 6 -1 37	-1 0 2 -2 28
-2 -1 7 4 62 9	-1 0 13 14 53 8	-1 0 13 14 42 5	-1 0 6 -1 37 3	-1 0 2 -2 28 4
-2 -1 7 4 62 9	-1 0 13 14 53 8	-1 0 13 14 42 5	-1 0 6 -1 37 3	-1 0 2 -2 28 4

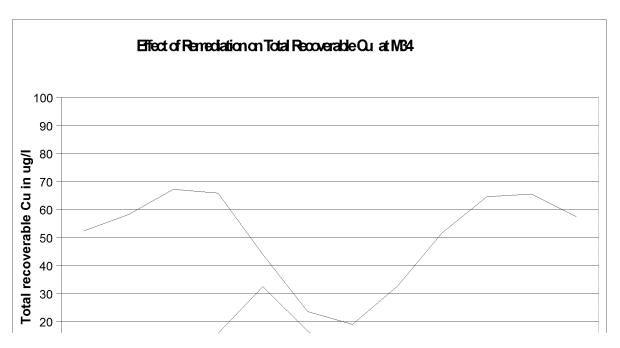

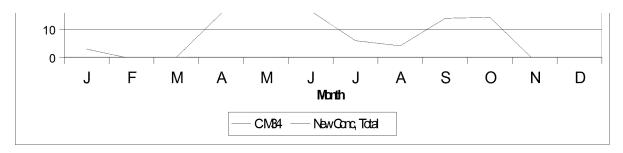

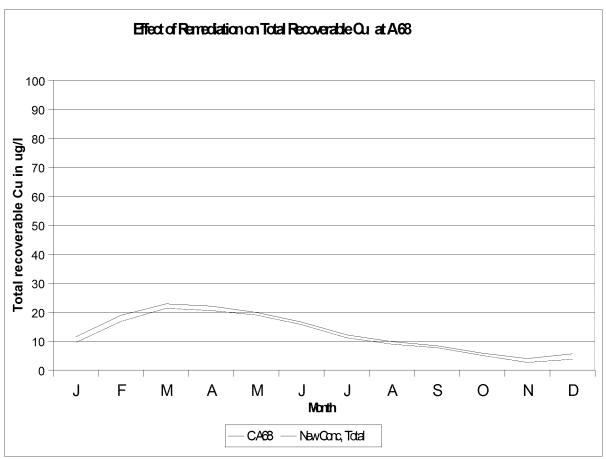

charge ir	n cfs				Copper (Concentrat	ion Coeffi	cients
	Intercept c	oefficient					B Ir	ntercept
	·	L	ow Flow Nove	mber-March	A	72	0.001	11.68205
M34	-2.771	0.394	-2.28954	0.38718	M	34	0.01	29.69
CC48	1.752	0.130	6.77165	0.10539		C48	1.00	95.55
A68	-11.131	0.498				68	0.00	26.09165
700	-11.101	0.430	-3.62869	0.45153		00	0.00	20.09100
Discharge F	Relationships am	ong the three	gages					
	MONTH	J	F	M	Α	M	J	J
	Intercept	1	1	1	1	1	1	1
	A 72	64	63	77	155	682	1196	625
	M34	22	22	28	58	266	468	243
	CC48	14	13	15	22	91	158	83
	A68	25	25	31	66	329	585	300
	Ground wate	3	3	3	9	-3	-14	-2
1/(1+BQ) D	ischarge Represe	entation						
(, _	A 72	0.9398	0.9407	0.9285	0.8658	0.5945	0.4554	0.6154
	M34	0.8361	0.8385	0.8066	0.6633	0.3016	0.1969	0.3205
	CC48	0.0689	0.0694	0.0629	0.0435	0.0109	0.0063	0.0119
	A68	0.9754	0.9758	0.9698	0.9380	0.7527	0.6311	0.7691
Date variab	les							
	sin	0.1552	0.6358	0.9276	0.9887	0.7862	0.3629	-0.1441
	cos	0.9879	0.7719	0.3737	-0.1496	-0.6180	-0.9318	-0.9896
	sin1	0.3066	0.9815	0.6932	-0.2959	-0.9717	-0.6763	0.2852
	cos1	0.9518	0.1916	-0.7207	-0.9552	-0.2361	0.7366	0.9585
	Consent	1	1	1	1	1	1	1
A72	Intercept	1	1	1	1	1	1	1
	BQ	0.9398	0.9407	0.9285	0.8658	0.5945	0.4554	0.6154
	sin	0.1552	0.6358	0.9276	0.9887	0.7862	0.3629	-0.1441
	cos	0.9879	0.7719	0.3737	-0.1496	-0.6180	-0.9318	-0.9896
	sin1	0.3066	0.9815	0.6932	-0.2959	-0.9717	-0.6763	0.2852
	cos1	0.9518	0.1916	-0.7207	-0.9552	-0.2361	0.7366	0.9585
	Consent	1.0000	1.0000	1.0000	1.0000	1.0000	1.0000	1.0000
A72 Con	centration	24	32	44	49	37	21	15
M34	Intercept	1	1	1	1	1	1	1
-	BQ	0.8361	0.8385	0.8066	0.6633	0.3016	0.1969	0.3205
	sin	0.1552	0.6358	0.9276	0.9887	0.7862	0.3629	-0.1441
	cos	0.9879	0.7719	0.3737	-0.1496	-0.6180	-0.9318	-0.9896
	sin1	0.3066	0.9815	0.6932	-0.2959	-0.9717	-0.6763	0.2852
	cos1	0.9518	0.1916	-0.7207	-0.9552	-0.2361	0.7366	0.9585
	Consent	1.0000	1.0000	1.0000	1.0000	1.0000	1.0000	1.0000
M34 Conce		52	58	67	66	44	24	19

CC 48	Intercept	1	1	1	1	1	1	1
	BQ	0.0689	0.0694	0.0629	0.0435	0.0109	0.0063	0.0119
	sin	0.1552	0.6358	0.9276	0.9887	0.7862	0.3629	-0.1441
	cos	0.9879	0.7719	0.3737	-0.1496	-0.6180	-0.9318	-0.9896
	sin1	0.3066	0.9815	0.6932	-0.2959	-0.9717	-0.6763	0.2852
	cos1	0.9518	0.1916	-0.7207	-0.9552	-0.2361	0.7366	0.9585
	Consent	1.0000	1.0000	1.0000	1.0000	1.0000	1.0000	1.0000
CC 48 Con	centratrion	36	35	41	58	86	90	85
A68	Intercept	1	1	1	1	1	1	1
	BQ	0.9754	0.9758	0.9698	0.9380	0.7527	0.6311	0.7691
	sin	0.1552	0.6358	0.9276	0.9887	0.7862	0.3629	-0.1441
	cos	0.9879	0.7719	0.3737	-0.1496	-0.6180	-0.9318	-0.9896
	sin1	0.3066	0.9815	0.6932	-0.2959	-0.9717	-0.6763	0.2852
	cos1	0.9518	0.1916	-0.7207	-0.9552	-0.2361	0.7366	0.9585
	Consent							
A68 Co	ncentration	12	19	23	22	20	17	12
Concentrat	ioı	32	39	45	44	32	20	16
Load in pou	unds per day							
	Total Cu	11	13	18	38	140	187	83
	Dis Cu	8	11	18	41	137	135	51
	% Difference	-0.26	-0.14	0.01	0.09	-0.02	-0.28	-0.39
	RPD	0.29	0.15	-0.01	-0.08	0.02	0.32	0.48

opper Conc	entration C	Coefficients	3			
	BQ s	in co	os s	sin1 c	cos1	Consent
	22.75607	7.43436	-0.44983	-3.82683_	-9.31243	0.00
	33.14	2.19	7.91	-4.53	-12.40	0.00
	-867.50	0.00	0.00	0.00	0.00	0.00
	-14.49469	8.15942	-0.05697		-2.43287	
	Α	S	0	N	D	
	1	1	1	1	1	
	268	187	142	92	70	
	103	71	53	33	25	
	37	26	20	16	14	
	122 6	82 8	60 9	38 4	28 3	
	O	8	9	4	3	
	0.7886	0.8425	0.8757	0.9158	0.9346	
	0.5276	0.6183	0.6835	0.7749	0.8222	
	0.0265	0.0368	0.0470	0.0572	0.0660	
	0.8910	0.9242	0.9438	0.9635	0.9728	
	0.0074	0.0000	0.0070	0.7740	0.0570	
	-0.6271 -0.7789	-0.9360 -0.3521	-0.9878 0.1556	-0.7716 0.6361	-0.3573 0.9340	
	0.9769	0.6591	-0.3074	-0.9816	-0.6674	
	0.2135	-0.7521	-0.9516	-0.1908	0.7447	
	1	1	1	1	1	
	4	4	4	4	4	
	0.7006	0.0425	0.9757	0.0159	0.9346	
	0.7886 -0.6271	0.8425 -0.9360	0.8757 -0.9878	0.9158 -0.7716	-0.3573	
	-0.6271 -0.7789	-0.9360 -0.3521	0.9676	0.6361	0.9340	
	0.9769	0.6591	-0.3074	-0.9816	-0.6674	
	0.2135	-0.7521	-0.9516	-0.1908	0.7447	
	1.0000	1.0000	1.0000	1.0000	1.0000	
	20	29	34	32	25	
	1	1	1	1	1	
	0.5276	0.6183	0.6835	0.7749	0.8222	
	-0.6271	-0.9360	-0.9878	-0.7716	-0.3573	
	-0.7789	-0.3521	0.1556	0.6361	0.9340	
	0.9769	0.6591	-0.3074	-0.9816	-0.6674	
	0.2135	-0.7521	-0.9516	-0.1908	0.7447	
	1.0000	1.0000	1.0000	1.0000	1.0000	
	33	52	65	66	57	

	1	1	1	1	1
	0.0660	0.0572	0.0470	0.0368	0.0265
	-0.3573	-0.7716	-0.9878	-0.9360	-0.6271
	0.9340	0.6361	0.1556	-0.3521	-0.7789
	-0.6674	-0.9816	-0.3074	0.6591	0.9769
	0.7447	-0.1908	-0.9516	-0.7521	0.2135
	1.0000	1.0000	1.0000	1.0000	1.0000
	38	46	55	64	73
	1	1	1	1	1
	0.9728	0.9635	0.9438	0.9242	0.8910
	-0.3573	-0.7716	-0.9878	-0.9360	-0.6271
	0.9340	0.6361	0.1556	-0.3521	-0.7789
	-0.6674	-0.9816	-0.3074	0.6591	0.9769
	0.7447	-0.1908	-0.9516	-0.7521	0.2135
	6	4	6	8	10
	U	7	U	O	10
	32	35	35	30	21
	12	17	28	34	40
	10	16	26	29	28
-0.15	-0.20	-0.09	-0.07	-0.15	-0.29
	0.22	0.09	0.07	0.16	0.33

A72								
	Chronic TV	S at A72			Pr	edicction I	Equation C	oefficients
	a2 b	2				Hardness A	AluminumC	Cadmium
Cd	-2.715	0.7852		В		0.006	1.000	0.006
Cu	-1.7428	0.8545		In	tercept	82.304	-26.540	1.020
Mn	5.8743	0.3331		В	Q	200.676?	5610.562	1.466
Zn	0.8669	0.8473		si	n	16.936	158.116	0.599
				CC	S	48.860	40.749	0.066
				si	n1	15.385	127.998	-0.265
				CC	s1	-5.633	6.691	-0.292
I				C	onsent			
	Month	J	F	М	Α	М	J	J
	Q	64	63	77	155	682	1196	625
	Hardness	277	290	268	196	91	53	72
	Al ch	87	87	87	87	87	87	87
	Cd ch	5.5	5.7	5.3	4.2	2.3	1.5	1.9
	Cu ch	11	11	10	8	4	3	3
	Mn ch	2317	2352	2290	2064	1598	1333	1481
	Zn ch	279	290	271	208	109	68	90

M 34								
			Predic	ction equa	tion coeffi	cients		
		Hardness Alu	minum	Cadmium	Copper	Iron	Zinc	
	В	0.013	1.00	0.021	0.123	0.06521	0.021	
	Intercept	60.05228315	.10361	0.91724	14.65129	77.70523	205.25873	
	BQ	205.02801338	.29032	0.60966	00.98354	370.29706	378.11589	
	sin	9.24827369	.03843	0.26911	14.16661	-89.38888	88.77920	
	cos	32.30173379	.08681	0.20991	10.17487	38.04002	85.94018	
	sin1	435	.43127	-0.12214	1.04278	186.24646	-17.99615	
	cos1	123	.10453	-0.14689	-3.82920	-12.30367	-45.60154	
	consent	-265	.10754	-	-10.75402	35.80515	-98.00378	
	MONTH	J	F	M	Α	М	J	J
Avg monthly	Q	22	. 22	28	58		468	243
	Hardness	255	241	226	170	86	60	76
Chronic Stan	Al, ch	87	87	87	87	87	87	87
	Cd,ch	2.4	2.3	2.1	1.7	1.0	0.8	0.9
	Cu ch	20	19	18	14	8	6	7

Mn	2253	2212	2163	1969	1571	1389	1504
Zn ch	260	248	235	185	104	76	93

A68 Anima	as at Silve	erton						
		Pre	diction	equation c	oefficients			
		Hardness Ca		•	Mangane:			
E	3	0.011na		na	0.010	0.016		
	ntercept	37.945	2.395	5.783	258.473	304.617		
E	3Q .	165.600			1371.923	644.136		
s	sin		1.712	2.049	611.024	315.451		
c	cos		0.140	0.729	81.662	-18.603		
s	sin1		-0.250	-1.520	16.031	-33.783		
c	cos1		-1.185	-0.472	-263.628	-140.108		
	Мау		-1.936	2.261	-258.699			
C	consent		-0.714	-1.828	411.428	-67.174		
Animas R	Month	J	F	М	Α	М	J	J
	Q	25	25	31	66	329	585	300
ŀ	Hardness	168	168	161	134	74	60	76
	Cd,tvs	1.7	1.7	1.7	1.4	0.9	8.0	0.9
	Cu tvs	14	14	13	11	7	6	7
	Mn tvs	1959	1961	1934	1818	1491	1393	1508
nic stand	Zn tvs	182	183	177	151	91	77	94

ction Equation Coeffic	cients			
Copper II	ron Z	Zinc		
0.100	0.048	0.014		
11.592	325.430	272.266		
-11.516 (5156.248	697.432		
5.618	310.323	155.229		
5.955	262.025	37.490		
1.700	-72.066	-37.359		
-0.594	-177.065	-77.421		
-1.491				
Α	S	0	N	D
268	187	142	92	70
124	158	182	215	248
87	87	87	87	87
2.9	3.5	3.9	4.5	5.0
5	7	7	9	10
1772	1920	2013	2129	2233
141	173	195	225	255

					VS at M34
	a2	b2	;	a3	b3
Cd	-3.	828	1.128	-3.49	0.7852
Cu	-0.7	703	0.9422	-1.7428	0.8545
Mn	4.4	995	0.7893	5.8743	0.3331
Zn	0.8	904	0.8473	0.8669	0.8473
Α	S		0	Ν	D
1	03	71	53	33	25
1	26	151	192	217	253
	87	87	87	87	87
	1.4	1.6	1.9	2.1	2.3
	11	13	16	17	20

1783	1892	2050	2136	2246
144	167	205	227	258

		Chronic TV a2 b	S at A68 2		
Cd		-3.49	0.7852		
Cu		-1.7428	0.7632		
Mn		5.8743			
Zn		0.8669	0.8473		
	Α	S	0	Ν	D
	122	82	60	38	28
	109	125	138	155	165
	1.2	1.4	1.5	1.6	1.7
	10	11	12	13	14
	1695	1777	1836	1908	1947
	126	142	155	171	180